



Safety Data Sheet

Issue Date 05-Sep-2019

Revision Date 05-Sep-2019

Revision Number 2

1. IDENTIFICATION

Product identifier

Product Code 1415-0900A
Product Name VINESTER CLEAR

Other means of identification

Common Name SERIES 1415, PART A
UN/ID no. 1263
Synonyms None

Recommended use of the chemical and restrictions on use

Recommended Use industrial paint.
Uses advised against Consumer use, For professional use only. Not for residential use.

Details of the supplier of the safety data sheet

Manufacturer Address

Tnemec Company, Inc. 6800 Corporate Drive, Kansas City, MO
64120-1372 816-474-3400

Distributor

Tnemec Company, Inc. 86 Boul, des Entreprises, Ste. 203,
Boisbriand, Quebec Canada J7G 2T3

Emergency telephone number

Company Phone Number Tnemec Regulatory Dept: 816-474-3400
24 Hour Emergency Phone Number 800-535-5053 (Infotrac)

2. HAZARDS IDENTIFICATION

Classification

OSHA Regulatory Status

This chemical is considered hazardous by the 2012 OSHA Hazard Communication Standard (29 CFR 1910.1200)

Acute toxicity - Inhalation (Vapors)	Category 4
Skin corrosion/irritation	Category 2
Serious eye damage/eye irritation	Category 2A
Germ cell mutagenicity	Category 1B
Carcinogenicity	Category 1B
Reproductive Toxicity	Category 2
Specific target organ toxicity (single exposure)	Category 3
Specific target organ toxicity (repeated exposure)	Category 1
Flammable Liquids	Category 3

Label elements

EMERGENCY OVERVIEW

Danger

Hazard statements

Harmful if inhaled
Causes skin irritation
Causes serious eye irritation
May cause genetic defects
May cause cancer
Suspected of damaging fertility or the unborn child

May cause respiratory irritation. May cause drowsiness or dizziness
 Causes damage to organs through prolonged or repeated exposure
 Flammable liquid and vapor



Appearance clear

Physical state liquid

Odor pungent

Precautionary Statements

Prevention

Obtain special instructions before use
 Do not handle until all safety precautions have been read and understood
 Use personal protective equipment as required
 Use only outdoors or in a well-ventilated area
 Wash face, hands and any exposed skin thoroughly after handling
 Do not breathe dust/fume/gas/mist/vapors/spray
 Do not eat, drink or smoke when using this product
 Keep away from heat/sparks/open flames/hot surfaces. — No smoking
 Keep container tightly closed
 Ground/bond container and receiving equipment
 Use only non-sparking tools
 Take precautionary measures against static discharge
 Use explosion-proof electrical/ventilating/lighting/mixing/equipment
 Keep cool

Response

IF exposed or concerned: Get medical advice/attention
 IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing
 If eye irritation persists: Get medical advice/attention
 If skin irritation occurs: Get medical advice/attention
 IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower
 Wash contaminated clothing before reuse
 IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing
 In case of fire: Use CO₂, dry chemical, or foam for extinction

Storage

Store locked up
 Store in a well-ventilated place. Keep container tightly closed
 Keep away from children

Disposal

Dispose of contents/container to an approved waste disposal plant

Hazards not otherwise classified (HNOC)

Other information

May be harmful if swallowed
 May be harmful in contact with skin
 Toxic to aquatic life with long lasting effects
 SEE SAFETY DATA SHEET
 Acute Toxicity

54.35529199 % of the mixture consists of ingredient(s) of unknown toxicity.

3. COMPOSITION/INFORMATION ON INGREDIENTS

Chemical name	CAS No.	Weight-%
STYRENE	100-42-5	30 - <60%
COBALT CARBOXYLATE	136-52-7	0.1 - <1%
MINERAL SPIRITS	8052-41-3	0.1 - <1%

*The exact percentage (concentration) of composition has been withheld as a trade secret.

4. FIRST AID MEASURES

Description of first aid measures

General advice	If symptoms persist, call a physician.
Eye contact	Rinse immediately with plenty of water, also under the eyelids, for at least 15 minutes. If symptoms persist, call a physician.
Skin contact	Wash off immediately with soap and plenty of water while removing all contaminated clothes and shoes. If symptoms persist, call a physician.
Inhalation	If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention immediately.
Ingestion	If swallowed, do not induce vomiting. Get medical attention immediately.
Self-protection of the first aider	Use personal protective equipment. Avoid contact with eyes, skin and clothing.

Most important symptoms and effects, both acute and delayed

Notes to physician Treat symptomatically.

5. FIRE-FIGHTING MEASURES

Suitable extinguishing media

Carbon dioxide. Foam. Dry chemical.

Unsuitable extinguishing media High volume water jet.

Specific hazards arising from the chemical

Thermal decomposition can lead to release of irritating gases and vapours In the event of fire and/or explosion do not breathe fumes

Hazardous combustion products Hazardous combustion products may include: A complex mixture of airborne solid and liquid particulates and gases (smoke). Carbon monoxide. Unidentified organic and inorganic compounds. Carbon oxides. Hydrocarbons.

Sensitivity to Static Discharge yes.

Protective equipment and precautions for firefighters

As in any fire, wear self-contained breathing apparatus pressure-demand, MSHA/NIOSH (approved or equivalent) and full protective gear.

6. ACCIDENTAL RELEASE MEASURES

Personal precautions, protective equipment and emergency procedures

Personal precautions Use personal protective equipment. Avoid contact with eyes, skin and clothing. Ensure adequate ventilation. Remove all sources of ignition. Take precautionary measures against static discharges.

Environmental Precautions

Environmental precautions Prevent further leakage or spillage if safe to do so. Do not allow material to contaminate ground water system.

Methods and material for containment and cleaning up

Methods for containment Remove all sources of ignition. Spills may be collected with inert, absorbent material for proper disposal. Use non-sparking tools, protective gloves, goggles and clothing, adequate ventilation, avoid the breathing of vapors and use respiratory protective devices. Transfer absorbent material to suitable containers for proper disposal.

Methods for cleaning up Pick up and transfer to properly labelled containers.

7. HANDLING AND STORAGE

Precautions for safe handling

Handling Handle in accordance with good industrial hygiene and safety practice. Wear personal protective equipment. Avoid contact with eyes, skin and clothing. Remove and wash contaminated clothing before re-use. Keep away from open flames, hot surfaces and sources of ignition. Take precautionary measures against static discharges. Do not breathe vapours or spray mist. Ensure adequate ventilation. In case of insufficient ventilation, wear suitable respiratory equipment. Do not ingest. Do not eat, drink or smoke when using this product. Wash thoroughly after handling.

Conditions for safe storage, including any incompatibilities

Storage Keep containers tightly closed in a dry, cool and well-ventilated place. Keep out of the reach of children.

Incompatible products Incompatible with oxidizing agents. Acids. Aluminum. Bases. copper. Halogenated compounds. Iron compounds. Metal salts. Peroxides.

8. EXPOSURE CONTROLS/PERSONAL PROTECTION

Control parameters

Exposure guidelines

Chemical name	ACGIH TLV	OSHA PEL	NIOSH IDLH
STYRENE 100-42-5	TWA: 20 ppm STEL: 40 ppm	TWA: 50 ppm TWA: 215 mg/m ³ STEL: 100 ppm STEL: 425 mg/m ³ TWA: 100 ppm Ceiling: 200 ppm	700 ppm
MINERAL SPIRITS 8052-41-3	TWA: 100 ppm	TWA: 100 ppm TWA: 525 mg/m ³ TWA: 500 ppm TWA: 2900 mg/m ³	20000 mg/m ³

Appropriate engineering controls

Engineering measures Sufficient ventilation, in volume and pattern, should be provided through both local and general exhaust to keep the air contaminant concentration below current applicable OSHA Permissible Exposure Limits (PEL) and ACGIH's Threshold Limit Values (TLV). Appropriate ventilation should be employed to remove hazardous decomposition products formed during welding or flame cutting operations of surfaces coated with this product.

Individual protection measures, such as personal protective equipment

Eye/face protection Use chemical resistant splash type goggles.

Skin and body protection Wear impervious protective clothing, including boots, gloves, lab coat, apron or coveralls, as appropriate, to prevent skin contact.

Respiratory protection

Use only with adequate ventilation. Do not breathe vapors, spray mist, or dust. Ensure fresh air entry during application and drying. If you experience eye watering, headache or dizziness or if air monitoring demonstrates vapor/mist or dust levels are above applicable limits, wear an appropriate, properly fitted respirator (NIOSH/MSHA approved) during and after application. Follow respirator manufacturer's directions for respirator use.

General hygiene considerations

Handle in accordance with good industrial hygiene and safety practice. Avoid breathing dust created by cutting, sanding, or grinding.

9. PHYSICAL AND CHEMICAL PROPERTIES

Information on basic physical and chemical properties

Physical state	liquid	Odor	pungent
Appearance	clear	Odor threshold	No information available
Color	No information available		

<u>Property</u>	<u>Values</u>	<u>Remarks</u>
pH		No data available
Melting point / freezing point	No data available	
Boiling point / boiling range	145 °C / 293 °F	
Flash point	31 °C / 87 °F	Pensky Martens - Closed Cup
Evaporation rate		No data available
Flammability (solid, gas)	No data available	
Flammability Limit in Air		No data available
Upper flammability limit	NA	
Lower flammability limit	NA	
Vapor pressure		No data available
Vapor density		No data available
Specific gravity	1.04093	g/cm3
Water solubility	Insoluble in cold water	
Solubility in other solvents		No data available
Partition coefficient: n-octanol/water		No data available
Autoignition temperature	No data available	No data available
Decomposition temperature	No information available	
Kinematic viscosity	No information available	
Dynamic viscosity		No data available

Other Information

Molecular weight	No information available
Density	8.68132 lbs/gal
Volatile organic compounds (VOC) content	3.87881 lbs/gal
Total volatiles weight percent	44.68 %
Total volatiles volume percent	51.39 %
Bulk density	No information available

10. STABILITY AND REACTIVITY

Reactivity

Stable under normal conditions

Chemical stability

Stable under recommended storage conditions.

Possibility of hazardous reactions

May occur.

Conditions to avoid

Heat, flames and sparks. Exposure to air. Extremes of temperature and direct sunlight.

Incompatible materials

Incompatible with oxidizing agents, Acids, Aluminum, Bases, copper, Halogenated compounds, Iron compounds, Metal salts, Peroxides

Hazardous decomposition products

Hazardous combustion products may include: A complex mixture of airborne solid and liquid particulates and gases (smoke). Carbon monoxide. Unidentified organic and inorganic compounds. Carbon oxides. Hydrocarbons.

11. TOXICOLOGICAL INFORMATION

Information on Likely Routes of Exposure

Inhalation	May cause central nervous system depression with nausea, headache, dizziness, vomiting, and incoordination. May cause irritation of respiratory tract.
Eye contact	Causes serious eye irritation.
Skin contact	Irritating to skin.
Ingestion	Harmful if swallowed.

Chemical name	LD50 Oral	LD50 Dermal	LC50 Inhalation
STYRENE 100-42-5	= 1000 mg/kg (Rat)	> 2000 mg/kg (Rat)	= 11.7 mg/L (Rat) 4 h
COBALT CARBOXYLATE 136-52-7	-	> 5000 mg/kg (Rabbit)	> 10 mg/L (Rat) 1 h

Information on toxicological effects

Symptoms Symptoms of overexposure are dizziness, headache, tiredness, nausea, unconsciousness, cessation of breathing. Irritating to eyes and skin. Irritating to respiratory system.

Delayed and immediate effects as well as chronic effects from short and long-term exposure

Chronic Toxicity Avoid repeated exposure. Prolonged exposure may cause chronic effects. Contains a known or suspected reproductive toxin. Contains a known or suspected carcinogen. Contains a known or suspected mutagen.

Sensitization No information available.

Mutagenicity Substances which should be regarded as being mutagenic to man.

Carcinogenicity The table below indicates whether each agency has listed any ingredient as a carcinogen.

Chemical name	ACGIH	IARC	NTP	OSHA
STYRENE 100-42-5		Group 2A	Reasonably Anticipated	X
COBALT CARBOXYLATE 136-52-7		Group 2B	Reasonably Anticipated	

Reproductive effects Product is or contains a chemical which is a known or suspected reproductive hazard.

STOT - single exposure Causes damage to organs

STOT - repeated exposure Causes damage to organs through prolonged or repeated exposure

Target organ effects Central nervous system, Eyes, liver, Reproductive System, respiratory system, Skin, hearing.

Aspiration hazard No information available.

Acute Toxicity 54.35529199 % of the mixture consists of ingredient(s) of unknown toxicity.

12. ECOLOGICAL INFORMATION

Ecotoxicity

Toxic to aquatic life with long lasting effects

54.3553 % of the mixture consists of component(s) of unknown hazards to the aquatic environment

Chemical name	Toxicity to algae	Toxicity to fish	Toxicity to daphnia

STYRENE 100-42-5	0.15 - 3.2: 96 h Pseudokirchneriella subcapitata mg/L EC50 static 0.46 - 4.3: 72 h Pseudokirchneriella subcapitata mg/L EC50 static 0.72: 96 h Pseudokirchneriella subcapitata mg/L EC50 1.4: 72 h Pseudokirchneriella subcapitata mg/L EC50	19.03 - 33.53: 96 h Lepomis macrochirus mg/L LC50 static 3.24 - 4.99: 96 h Pimephales promelas mg/L LC50 flow-through 58.75 - 95.32: 96 h Poecilia reticulata mg/L LC50 static 6.75 - 14.5: 96 h Pimephales promelas mg/L LC50 static	3.3 - 7.4: 48 h Daphnia magna mg/L EC50
---------------------	--	---	---

Persistence and degradability

No information available.

Bioaccumulation

No information available.

Mobility in Environmental Media

Chemical name	log Pow
STYRENE 100-42-5	2.95

Other Adverse Effects

No information available

13. DISPOSAL CONSIDERATIONS

Waste treatment methods

Disposal Methods

It must undergo special treatment, e.g. at suitable disposal site, to comply with local regulations.

Contaminated packaging

Empty containers should be taken to an approved waste handling site for recycling or disposal.

US EPA Waste Number

Chemical name	RCRA	RCRA - Basis for Listing	RCRA - D Series Wastes	RCRA - U Series Wastes
NAPHTHALENE 91-20-3	U165	Included in waste streams: F024, F025, F034, F039, K001, K035, K060, K087, K145		U165
ETHYLBENZENE 100-41-4		Included in waste stream: F039		
METHANOL 67-56-1		Included in waste stream: F039		U154

Chemical name	CAWAST
STYRENE 100-42-5	Toxic Ignitable
COBALT CARBOXYLATE 136-52-7	Toxic

14. TRANSPORT INFORMATION

DOT

UN/ID no. 1263
Proper Shipping Name PAINT
Hazard Class 3
Packing Group III
Emergency Response Guide Number 128

Additional information

Call TNE MEC Traffic Department - 816-474-3400 for additional information or other modes of Transportation.

15. REGULATORY INFORMATION

International Inventories

TSCA	Complies
DSL/NDSL	Complies
EINECS/ELINCS	Complies
ENCS	Complies
IECSC	Complies
KECL	Complies
PICCS	Complies
AICS	Complies

TSCA - United States Toxic Substances Control Act Section 8(b) Inventory
 DSL/NDSL - Canadian Domestic Substances List/Non-Domestic Substances List
 EINECS/ELINCS - European Inventory of Existing Commercial Chemical Substances/EU List of Notified Chemical Substances
 ENCS - Japan Existing and New Chemical Substances
 IECSC - China Inventory of Existing Chemical Substances
 KECL - Korean Existing and Evaluated Chemical Substances
 PICCS - Philippines Inventory of Chemicals and Chemical Substances
 AICS - Australian Inventory of Chemical Substances

The following chemical(s) are listed as HAP under the U.S. Clean Air Act, Section 12 (40 CFR 61):

Chemical name	HAPS Data
STYRENE	
COBALT CARBOXYLATE	

SARA 313

Section 313 of Title III of the Superfund Amendments and Reauthorization Act of 1986 (SARA). This product contains a chemical or chemicals which are subject to the reporting requirements of the Act and Title 40n of the Code of Federal Regulations, Part 372:

Chemical name	SARA 313 - Threshold Values
STYRENE - 100-42-5	0.1
COBALT CARBOXYLATE - 136-52-7	1.0

SARA 311/312 Hazardous

Categorization

Acute Health Hazard	Yes
Chronic Health Hazard	Yes
Fire Hazard	Yes
Sudden Release of Pressure Hazard	No
Reactive Hazard	Yes

Clean Water Act

Chemical name	CWA - Reportable Quantities	CWA - Toxic Pollutants	CWA - Priority Pollutants	CWA - Hazardous Substances
STYRENE 100-42-5	1000 lb			X

CERCLA

Chemical name	Hazardous Substances RQs	CERCLA EHS RQs	RQ
STYRENE 100-42-5	1000 lb		RQ 1000 lb final RQ RQ 454 kg final RQ

California Prop. 65

WARNING: This product can expose you to the following chemicals which are known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.

Chemical name	California Prop. 65
STYRENE - 100-42-5	Carcinogen

NAPTHALENE - 91-20-3	Carcinogen
ETHYLBENZENE - 100-41-4	Carcinogen
METHANOL - 67-56-1	Developmental

California SCAQMD Rule 443

Contains Photochemically Reactive Solvent

State Right-to-Know

Chemical name	New Jersey	Massachusetts	Pennsylvania
STYRENE 100-42-5	X	X	X
COBALT CARBOXYLATE 136-52-7	X		X
MINERAL SPIRITS 8052-41-3	X	X	X

16. OTHER INFORMATION

NFPA	Health 3	Flammability 3	Instability 2	Physical hazard -
HMIS (Hazardous Material Information System)	Health 3*	Flammability 3	Reactivity 2	


Prepared By Tnemec Regulatory Dept: 816-474-3400
 Revision Date 05-Sep-2019
 Revision Summary
 1 9 5 6 7 10 8 11 13 14 15

Disclaimer

For specific information regarding occupational safety and health standards, please refer to the Code of Federal Regulations, Title 29, Part 1910.

To the best of our knowledge, the information contained herein is accurate. However, neither the Tnemec Company or any of its subsidiaries assume any liability whatsoever for the accuracy of completeness of the information contained herein. Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown health hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards which exist.

End of SDS

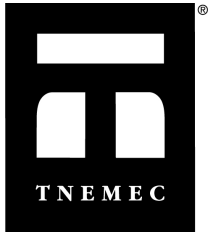

Safety Data Sheet

Issue Date 13-Jan-2020

Revision Date 13-Jan-2020

Revision Number 4

1. IDENTIFICATION

Product identifier

Product Code 1402-0001B
Product Name PROPOLYMER CATALYST

Other means of identification

Common Name SERIES 469-1439, PART B
UN/ID no. 1263
Synonyms None

Recommended use of the chemical and restrictions on use

Recommended Use industrial paint.
Uses advised against Consumer use, For professional use only. Not for residential use.

Details of the supplier of the safety data sheet

Manufacturer Address Tnemec Company, Inc. 6800 Corporate Drive, Kansas City, MO 64120-1372 816-474-3400
Distributor Tnemec Company, Inc. 86 Boul, des Entreprises, Ste. 203, Boisbriand, Quebec Canada J7G 2T3

Emergency telephone number

Company Phone Number Tnemec Regulatory Dept: 816-474-3400
24 Hour Emergency Phone Number 800-535-5053 (Infotrac)

2. HAZARDS IDENTIFICATION

Classification

OSHA Regulatory Status

This chemical is considered hazardous by the 2012 OSHA Hazard Communication Standard (29 CFR 1910.1200)

Acute toxicity - Oral	Category 4
Acute toxicity - Dermal	Category 4
Acute toxicity - Inhalation (Dusts/Mists)	Category 3
Skin corrosion/irritation	Category 1 Sub-category A
Serious eye damage/eye irritation	Category 1
Specific target organ toxicity (repeated exposure)	Category 2
Aspiration toxicity	Category 1
Organic Peroxides	Type F
Flammable Liquids	Category 3

Label elements

EMERGENCY OVERVIEW

Danger

Hazard statements

Toxic if inhaled
Causes severe skin burns and eye damage
May cause damage to organs through prolonged or repeated exposure
May be fatal if swallowed and enters airways
Heating may cause a fire
Flammable liquid and vapor

**Appearance** yellow**Physical state** liquid**Odor** Strong aromatic**Precautionary Statements****Prevention**

Wash face, hands and any exposed skin thoroughly after handling
 Do not eat, drink or smoke when using this product
 Wear protective gloves/protective clothing/eye protection/face protection
 Use only outdoors or in a well-ventilated area
 Do not breathe dust/fume/gas/mist/vapors/spray
 Keep away from heat/sparks/open flames/hot surfaces. — No smoking
 Keep container tightly closed
 Ground/bond container and receiving equipment
 Use only non-sparking tools
 Take precautionary measures against static discharge
 Keep only in original container
 Keep cool
 Use explosion-proof electrical/ventilating/lighting/mixing/equipment

Response

Immediately call a POISON CENTER or doctor/physician
 IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing
 Immediately call a POISON CENTER or doctor/physician
 Call a POISON CENTER or doctor/physician if you feel unwell
 Wash contaminated clothing before reuse
 IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower
 IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing
 Immediately call a POISON CENTER or doctor/physician
 Rinse mouth
 IF SWALLOWED: Immediately call a POISON CENTER or doctor/physician
 Do NOT induce vomiting
 In case of fire: Use CO₂, dry chemical, or foam for extinction

Storage

Store locked up
 Store in a well-ventilated place. Keep container tightly closed
 Store at temperatures not exceeding 38 °C/ 100 °F. Keep cool
 Store away from other materials
 Protect from sunlight
 Keep away from children

Disposal

Dispose of contents/container to an approved waste disposal plant

Hazards not otherwise classified (HNOC)**Other information**

Toxic to aquatic life with long lasting effects
 SEE SAFETY DATA SHEET

Acute Toxicity

0 % of the mixture consists of ingredient(s) of unknown toxicity.

3. COMPOSITION/INFORMATION ON INGREDIENTS

Chemical name	CAS No.	Weight-%
CUMENE HYDROPEROXIDE	80-15-9	60 - 100%
CUMYL ALCOHOL	617-94-7	1 - <10%
(1-METHYLETHYL)BENZENE	-	1 - <10%
ACETOPHENONE	98-86-2	1 - <10%

*The exact percentage (concentration) of composition has been withheld as a trade secret.

4. FIRST AID MEASURES

Description of first aid measures

General advice	In case of accident or if you feel unwell, seek medical advice immediately (show the label where possible).
Eye contact	Immediately flush with plenty of water. After initial flushing, remove any contact lenses and continue flushing for at least 15 minutes. Keep eye wide open while rinsing. Immediate medical attention is required.
Skin contact	Wash off immediately with soap and plenty of water while removing all contaminated clothes and shoes. Remove and wash contaminated clothing before re-use. If symptoms persist, call a physician.
Inhalation	Remove affected individual to fresh air. Treat symptomatically. If breathing is difficult, administer oxygen. If breathing has stopped give artificial respiration. Consult a physician. Avoid direct contact with skin. Use barrier to give mouth-to-mouth resuscitation.
Ingestion	Immediate medical attention is required. Rinse mouth. Drink plenty of water. Do not induce vomiting without medical advice. Never give anything by mouth to an unconscious person.
Self-protection of the first aider	Use personal protective equipment. Remove all sources of ignition.

Most important symptoms and effects, both acute and delayed

Most important symptoms and effects Causes burns to skin and eyes. MAY CAUSE BLINDNESS. Coughing and / or wheezing.

Notes to physician Treat symptomatically.

5. FIRE-FIGHTING MEASURES

Suitable extinguishing media

Use extinguishing measures that are appropriate to local circumstances and the surrounding environment. Carbon dioxide. Dry chemical. Water spray. Foam.

Unsuitable extinguishing media Do not use a solid water stream as it may scatter and spread fire.

Specific hazards arising from the chemical

Thermal decomposition can lead to release of irritating gases and vapours. In the event of fire and/or explosion do not breathe fumes.

Hazardous combustion products Hazardous combustion products may include: A complex mixture of airborne solid and liquid particulates and gases (smoke). Carbon monoxide. Unidentified organic and inorganic compounds. Carbon oxides.

Protective equipment and precautions for firefighters

As in any fire, wear self-contained breathing apparatus pressure-demand, MSHA/NIOSH (approved or equivalent) and full protective gear. Avoid run off to waterways and sewers.

6. ACCIDENTAL RELEASE MEASURES

Personal precautions, protective equipment and emergency procedures

Personal precautions Remove all sources of ignition. Evacuate personnel to safe areas. Ensure adequate ventilation, especially in confined areas. Use personal protective equipment. Keep people away from and upwind of spill/leak.

Environmental Precautions

Environmental precautions Prevent further leakage or spillage if safe to do so. Prevent product from entering drains. Do not flush into surface water or sanitary sewer system.

Methods and material for containment and cleaning up

Methods for containment Remove all sources of ignition. Spills may be collected with inert, absorbent material for proper disposal. Use non-sparking tools, protective gloves, goggles and clothing, adequate ventilation, avoid the breathing of vapors and use respiratory protective devices. Transfer absorbent material to suitable containers for proper disposal.

Methods for cleaning up Pick up and transfer to properly labelled containers.

7. HANDLING AND STORAGE**Precautions for safe handling**

Handling Ensure adequate ventilation, especially in confined areas. Keep away from heat, sparks, flame and other sources of ignition (i.e., pilot lights, electric motors and static electricity). Take precautionary measures against static discharges. Use spark-proof tools and explosion-proof equipment. Use with local exhaust ventilation. Wear personal protective equipment. Do not breathe vapours or spray mist.

Conditions for safe storage, including any incompatibilities

Storage Keep container tightly closed in a dry and well-ventilated place. Keep in properly labeled containers. Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Store at temperatures not exceeding 38 °C/ 100 °F. Keep cool. Do not store near combustible materials.

Packaging materials Keep only in original container.

Incompatible products Strong acids. Strong bases. Strong oxidizing agents. Amines. Metals. SALT. Reducing agents.

8. EXPOSURE CONTROLS/PERSONAL PROTECTION**Control parameters****Exposure guidelines**

Chemical name	ACGIH TLV	OSHA PEL	NIOSH IDLH
(1-METHYLETHYL)BENZENE	TWA: 50 ppm	TWA: 50 ppm TWA: 245 mg/m ³ Skin	900 ppm
ACETOPHENONE 98-86-2	TWA: 10 ppm	-	

Appropriate engineering controls

Engineering measures Sufficient ventilation, in volume and pattern, should be provided through both local and general exhaust to keep the air contaminant concentration below current applicable OSHA Permissible Exposure Limits (PEL) and ACGIH's Threshold Limit Values (TLV). Appropriate ventilation should be employed to remove hazardous decomposition products formed during welding or flame cutting operations of surfaces coated with this product.

Individual protection measures, such as personal protective equipment

Eye/face protection	Tightly fitting safety goggles If splashes are likely to occur, wear face-shield.
Skin and body protection	Wear impervious protective clothing, including boots, gloves, lab coat, apron or coveralls, as appropriate, to prevent skin contact.
Respiratory protection	Use only with adequate ventilation. Do not breathe vapors, spray mist, or dust. Ensure fresh air entry during application and drying. If you experience eye watering, headache or dizziness or if air monitoring demonstrates vapor/mist or dust levels are above applicable limits, wear an appropriate, properly fitted respirator (NIOSH/MSHA approved) during and after application. Follow respirator manufacturer's directions for respirator use.
General hygiene considerations	Handle in accordance with good industrial hygiene and safety practice. Avoid breathing dust created by cutting, sanding, or grinding.

9. PHYSICAL AND CHEMICAL PROPERTIES**Information on basic physical and chemical properties**

Physical state	liquid	Odor	Strong aromatic
Appearance	yellow	Odor threshold	No information available
Color	No information available		

<u>Property</u>	<u>Values</u>	<u>Remarks</u>
pH		No data available
Melting point / freezing point	No data available	
Boiling point / boiling range	> 100 °C / 212 °F	
Flash point	56 °C / 133.00 °F	Pensky Martens - Closed Cup
Evaporation rate	< 1	
Flammability (solid, gas)	No data available	
Flammability Limit in Air		No data available
Upper flammability limit	NA	
Lower flammability limit	NA	
Vapor pressure		No data available
Vapor density		No data available
Specific gravity	1.03118 1.0324	g/cm3
Water solubility	slightly soluble	
Solubility in other solvents		No data available
Partition coefficient: n-octanol/water		No data available
Autoignition temperature	No data available	No data available
Decomposition temperature	> 60° C	
Kinematic viscosity	No information available	No data available
Dynamic viscosity		No data available

Other Information

Molecular weight	No information available
Density	8.60001 lbs/gal
Volatile organic compounds (VOC) content	1.075 lbs/gal
Total volatiles weight percent	12.5 %
Total volatiles volume percent	12.3 %
Bulk density	No information available

10. STABILITY AND REACTIVITY**Reactivity**

Stable under normal conditions

Chemical stability

Stable under recommended storage conditions.

Possibility of hazardous reactions

Vapors may form explosive mixtures with air.

Conditions to avoid

Keep away from open flames, hot surfaces and sources of ignition. Temperatures above 38°C.

Incompatible materials

Strong acids, Strong bases, Strong oxidizing agents, Amines, Metals, SALT, Reducing agents

Hazardous decomposition products

Hazardous combustion products may include: A complex mixture of airborne solid and liquid particulates and gases (smoke). Carbon monoxide. Unidentified organic and inorganic compounds. Carbon oxides.

11. TOXICOLOGICAL INFORMATION

Information on Likely Routes of Exposure

Inhalation	Irritating to respiratory system. May be harmful by inhalation. May cause central nervous system depression with nausea, headache, dizziness, vomiting, and incoordination.
Eye contact	Corrosive to the eyes and may cause severe damage including blindness.
Skin contact	Causes burns.
Ingestion	Harmful if swallowed. Potential for aspiration if swallowed.

Chemical name	LD50 Oral	LD50 Dermal	LC50 Inhalation
CUMENE HYDROPEROXIDE 80-15-9	= 382 mg/kg (Rat)	= 0.126 mL/kg (Rabbit)	= 220 ppm (Rat) 4 h
CUMYL ALCOHOL 617-94-7	= 1300 mg/kg (Rat)	= 1 mL/kg (Rabbit) = 4300 mg/kg (Rabbit)	-
(1-METHYLETHYL)BENZENE	= 1400 mg/kg (Rat)	= 12300 µL/kg (Rabbit)	= 39000 mg/m ³ (Rat) 4 h > 3577 ppm (Rat) 6 h
ACETOPHENONE 98-86-2	= 815 mg/kg (Rat) = 900 mg/kg (Rat)	= 1760 mg/kg (Rabbit)	> 2.130 mg/L (Rat) 8 h

Information on toxicological effects

Symptoms Avoid repeated exposure. MAY CAUSE BLINDNESS. Causes severe skin burns. Coughing and/ or wheezing.

Delayed and immediate effects as well as chronic effects from short and long-term exposure

Skin corrosion/irritation Causes severe burns.
Eye damage/irritation Risk of serious damage to eyes.
Chronic Toxicity NOTICE: Reports have associated repeated and prolonged occupational overexposure to solvents with permanent brain and nervous system damage. Intentional misuse by deliberately concentrating and inhaling the contents may be harmful or fatal. Avoid repeated exposure. Causes burns to skin and eyes. Aspiration hazard.
Sensitization No information available.
Mutagenicity No information available.
Carcinogenicity The table below indicates whether each agency has listed any ingredient as a carcinogen.

Chemical name	ACGIH	IARC	NTP	OSHA
(1-METHYLETHYL)BENZENE		Group 2B	Reasonably Anticipated	X

Reproductive effects No information available.
STOT - single exposure No information available
STOT - repeated exposure Causes damage to organs through prolonged or repeated exposure
Target organ effects Eyes, respiratory system, Skin, Central nervous system.

Aspiration hazard May be harmful if swallowed and enters airways.

Acute Toxicity 0 % of the mixture consists of ingredient(s) of unknown toxicity.

12. ECOLOGICAL INFORMATION

Ecotoxicity

Toxic to aquatic life with long lasting effects

6 % of the mixture consists of component(s) of unknown hazards to the aquatic environment

Chemical name	Toxicity to algae	Toxicity to fish	Toxicity to daphnia
CUMENE HYDROPEROXIDE 80-15-9	-	3.9: 96 h Oncorhynchus mykiss mg/L LC50 static	7: 24 h Daphnia magna mg/L EC50
(1-METHYLETHYL)BENZENE	2.6: 72 h Pseudokirchneriella subcapitata mg/L EC50	6.04 - 6.61: 96 h Pimephales promelas mg/L LC50 flow-through 4.8: 96 h Oncorhynchus mykiss mg/L LC50 flow-through 2.7: 96 h Oncorhynchus mykiss mg/L LC50 semi-static 5.1: 96 h Poecilia reticulata mg/L LC50 semi-static	0.6: 48 h Daphnia magna mg/L EC50 7.9 - 14.1: 48 h Daphnia magna mg/L EC50 Static
ACETOPHENONE 98-86-2	-	162: 96 h Pimephales promelas mg/L LC50 flow-through 155: 96 h Pimephales promelas mg/L LC50 static	-

Persistence and degradability

No information available.

Bioaccumulation

No information available.

Mobility in Environmental Media

Chemical name	log Pow
(1-METHYLETHYL)BENZENE	3.55
ACETOPHENONE 98-86-2	1.58

Other Adverse Effects

No information available

13. DISPOSAL CONSIDERATIONS

Waste treatment methods

Disposal Methods

It must undergo special treatment, e.g. at suitable disposal site, to comply with local regulations.

Contaminated packaging

Do not reuse container. Empty containers should be taken to an approved waste handling site for recycling or disposal.

US EPA Waste Number

Chemical name	RCRA	RCRA - Basis for Listing	RCRA - D Series Wastes	RCRA - U Series Wastes
CUMENE HYDROPEROXIDE 80-15-9				U096
(1-METHYLETHYL)BENZENE				U055
ACETOPHENONE 98-86-2	U004	Included in waste stream: F039		U004

California Hazardous Waste Status

Chemical name	CAWAST
CUMENE HYDROPEROXIDE 80-15-9	Toxic Ignitable
(1-METHYLETHYL)BENZENE	Toxic Ignitable

14. TRANSPORT INFORMATION

DOT

UN/ID no. 1263
 Proper Shipping Name PAINT
 Hazard Class 3
 Packing Group III
 Emergency Response Guide Number 128

Additional information

Call TNE MEC Traffic Department - 816-474-3400 for additional information or other modes of Transportation.

15. REGULATORY INFORMATION

International Inventories

TSCA Complies
 DSL/NDL Complies
 EINECS/ELINCS Complies
 ENCS Complies
 IECSC Complies
 KECL Complies
 PICCS Complies
 AICS Complies

- TSCA - United States Toxic Substances Control Act Section 8(b) Inventory
- DSL/NDL - Canadian Domestic Substances List/Non-Domestic Substances List
- EINECS/ELINCS - European Inventory of Existing Commercial Chemical Substances/EU List of Notified Chemical Substances
- ENCS - Japan Existing and New Chemical Substances
- IECSC - China Inventory of Existing Chemical Substances
- KECL - Korean Existing and Evaluated Chemical Substances
- PICCS - Philippines Inventory of Chemicals and Chemical Substances
- AICS - Australian Inventory of Chemical Substances

The following chemical(s) are listed as HAP under the U.S. Clean Air Act, Section 12 (40 CFR 61):

Chemical name	HAPS Data
(1-METHYLETHYL)BENZENE	
ACETOPHENONE	

SARA 313

Section 313 of Title III of the Superfund Amendments and Reauthorization Act of 1986 (SARA). This product contains a chemical or chemicals which are subject to the reporting requirements of the Act and and Title 40n of the Code of Federal Regulations, Part 372:

Chemical name	SARA 313 - Threshold Values
CUMENE HYDROPEROXIDE - 80-15-9	1.0
(1-METHYLETHYL)BENZENE -	1.0
ACETOPHENONE - 98-86-2	1.0

SARA 311/312 Hazardous Categorization

Acute Health Hazard Yes

Chronic Health Hazard	Yes
Fire Hazard	Yes
Sudden Release of Pressure Hazard	No
Reactive Hazard	No

CERCLA

Chemical name	Hazardous Substances RQs	CERCLA EHS RQs	RQ
CUMENE HYDROPEROXIDE 80-15-9	10 lb		RQ 10 lb final RQ RQ 4.54 kg final RQ
(1-METHYLETHYL)BENZENE	5000 lb		RQ 5000 lb final RQ RQ 2270 kg final RQ
ACETOPHENONE 98-86-2	5000 lb		RQ 5000 lb final RQ RQ 2270 kg final RQ

California Prop. 65

WARNING: This product can expose you to the following chemicals which are known to the State of California to cause cancer. For more information go to www.P65Warnings.ca.gov.

Chemical name	California Prop. 65
(1-METHYLETHYL)BENZENE -	Carcinogen

California SCAQMD Rule 443

Contains Photochemically Reactive Solvent

State Right-to-Know

Chemical name	New Jersey	Massachusetts	Pennsylvania
CUMENE HYDROPEROXIDE 80-15-9	X	X	X
(1-METHYLETHYL)BENZENE	X	X	X
ACETOPHENONE 98-86-2	X	X	X

16. OTHER INFORMATION

NFPA	Health 3	Flammability 2	Instability 1	Physical hazard -
HMIS (Hazardous Material Information System)	Health 3*	Flammability 2	Reactivity 1	

Prepared By Tnemec Regulatory Dept: 816-474-3400
Revision Date 13-Jan-2020

Revision Summary
1 9 4 5 6 7 10 8 11 13 14 15

Disclaimer

For specific information regarding occupational safety and health standards, please refer to the Code of Federal Regulations, Title 29, Part 1910.

To the best of our knowledge, the information contained herein is accurate. However, neither the Tnemec Company or any of its subsidiaries assume any liability whatsoever for the accuracy or completeness of the information contained herein. Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown health hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards which exist.

End of SDS